Service Bulletin

LifeFitness

SB No.FZ04071301N

Original Date	Revised Date	Problem Code	Type Code	Status	Author
Jul 13, 2004	New	None	N/A	New	Terry Johnson

Subject: FZBE Adjustment Pin Is Not Working Properly

Serial Number: All

Time Required: ☐15 min ☒30 min ☐45 min ☐1 hr +

Distribute To: ☒Internal ☒Dealer ☒ISO ☒Customer

DESCRIPTION:

Adjustment pin is not working properly.

SOLUTION:

The following replacement parts are required:

1. 7748701 Spring
2. 3110011 Roll Pin
3. 7767101 Pull Pin

1. Disconnect the gas spring from foot-bar. Use flat screwdriver to release metal clip.
2. Using a hammer and center punch, drive the roll pin out of the small hole in the pull pin.
3. Loosen two M10 bolts from the foot-bar, and then remove the foot-bar.
4. Replace the pull pin and spring.
5. Re-assemble as before.

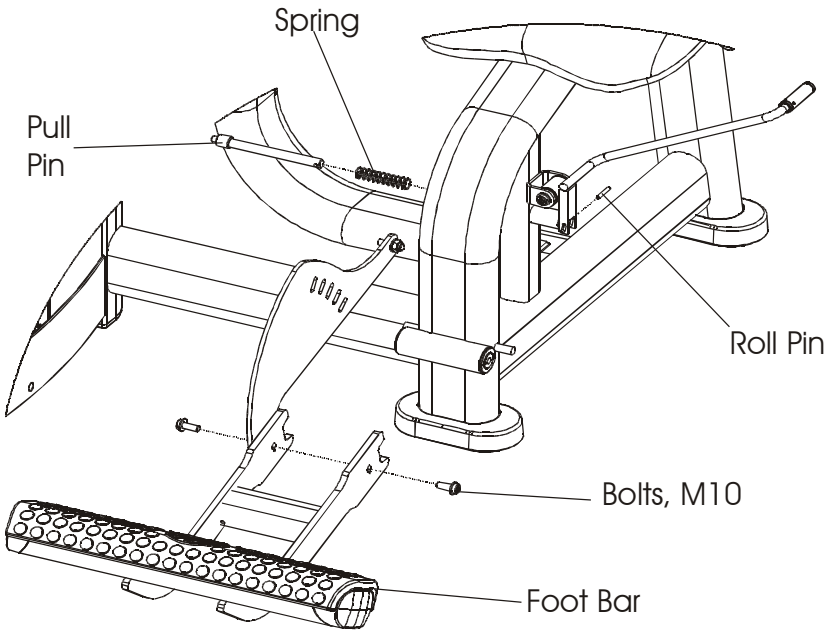

Life Fitness Proprietary and Confidential Information - Only for the Use of the Intended Recipient - Do Not Reproduce or Distribute.